


The gradual starter is used in pneumatic circuits where a cut-off in pressure, an abrupt start-up is to be avoided to prevent possible damages to equipment.

FUNCTIONING PRINCIPLE: 2 way valve which, in the stand-by position, allows the passage of an air regulated flow. When the working pressure is reached the valve allows the air full passage.


Size	0
Part No.	HZE0Y08G
Threaded port	G1/4
Flow rate (NI/min) ^(A)	900
Max inlet pressure (bar-MPa-psi)	10-1-145
Min pressure (bar)	2
Fluid	compressed air
Temperature (°C)	-20 ÷ 80
Weight (Kg)	0,300

(A) = inlet pressure 6 bar, outlet pressure 5 bar - Δp 1 bar

HZE-Y

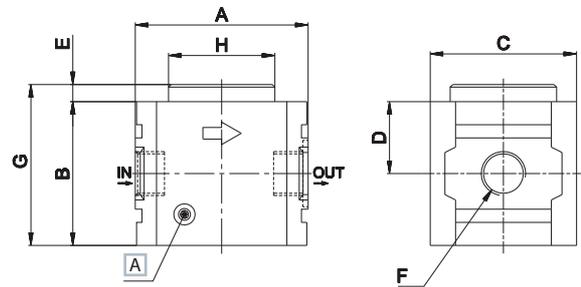

A Regulating screw

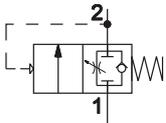

size	A	B	C	D	E	F	G	Ø H
0	55	55	40	27,5	6,5	G1/4	61,5	40

